PROJECT: SRMS (-5 MCIU INSTALLED)
ASS'Y HOMENCLATURE: DEC PANEL

SYSTEM: D&C SUBSYSTEM ASS'Y P/N: 51140E391

-	SHEET:	

FMEA REJ.	FMEA REV.	NAME, OTY, & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HDWR / FUNC. RATIONALE FOR ACCEPTANCE 2/1R RETICAL DAY SCREENS: A DASC D. DAGS C. DAGS
1035	O	DESIGNATION MCIU-DAC DATA INTERFACE QTY-1 SCHEMATIC ED 87305	CAUSE HODE: LOSS OF DATA BUS. CAUSE(S): (1) LOSS OF STROBE SIGNAL. (2) LOSS OF CLOCK SIGNAL.	END ITEM LOSS OF COMMUNICATION WITH D&C INTERFACE WILL INTITIATE D&C COMMUNICATION FAILURE DETECTION. AUTOBRAKES. ARM COMES TO REST. GPC GOES INTO TOLE MODE. LOSS OF COMPUTER SUPPORTED MODES. D&C COMMAND DATA IS HOT UPDATED. LOSS OF LIMPING	CRITICALETY SCREENS: A-PASS, B-PASS, C-PASS DESIGN FEATURES PROCESSING OF THE CLOCK AND OF THE STROBE SIGNAL, IS PERFORMED BY THREE ACTIVE EEE PARIS. EACH SIGNAL IS BUFFERED BY A COMPLEMENTARY TRANSISTOR PARR (2N2222A AND 2N2907A) AND SHAPED BY A CHOS SCHMIDT TRIGGER GATE (4093). CMOS DEVICES OPERATE AT LOW POWER AND HENCE DO NOT EMPERIENCE SIGNIFICANT OPERATING STRESSES. THE TECHNOLOGY IS MATURE, AND DEVICE RELIABILITY HISTORY IS WELL DOCUMENTED. ALL STRESSES ARE ADDITIONALLY REDUCED BY DERATING THE APPROPRIATE PARAMETERS IN ACCORDANCE WITH SPAR-RMS-PA.003. SPECIAL HANDLING PRECAUTIONS ARE USED AT ALL STAGES OF MANUFACTURE TO PRECLUDE DAMAGE/STRESS DUE TO ELECTROSTATIC DISCHARGE. DISCRETE SEMICONDUCTOR DEVICES SPECIFIED TO AT LEAST THE TK LEVEL OF MIL-S-1950D. ALL DEVICES ARE SUBJECTED TO RE-SCREENING BY AN INDEPENDANT TEST HOUSE. SAMPLES OF ALL
				DURING END EFFECTOR CAPTURE. FOR CAUSE 1: DEC RESPONSE DATA IS ALL "U'S". FOR CAUSE 2: DEC RESPONSE DATA FAILS TO ALL "I'S" OR "U'S". LF DEC	ANALYSIS (DPA) TO VERIFY THE INTEGRITY OF THE MANUFACTURING PROCESSES. DEVICE STRESS LEVELS ARE, DERATED IN ACCORDANCE WITH SPAR-RMS-PA.003 AND VERIFIED BY DESIGN REVIEW. EEE PARTS HAVE BEEN SELECTED AND CONTROLLED IN ACCORDANCE WITH SPAR-RMS-PA.003. THIS DOCUMENT DEFINES THE PROGRAM REQUIREMENTS FOR MONIFORING AND CONTROLLING EEE PARTS. THE RECUIREMENTS FOR MONIFORING AND CONTROLLING EEE PARTS. THE RECUIREMENTS INCLUDE PARTS SELECTION TO AT LEAST "ESTABLISHED RELIABILITY" LEVELS, AND ADEQUATE DERATING OF PART STRESS LE ELS. PROCEDURES AND ACTIVITIES ARE SPECIFIED TO ENSURE AT LEAST EQUIVALENT QUALITY FOR MONSTANDARD AND IRREGULAR PARTS. RELIABILITY ANALYSIS HAS CONFIRMED NO PARTS WITH GENERICALLY BIGH FAILURE RATES. ARCOSPACE DESIGN STANDARDS FOR DETAILING ELECTRONIC PARTS PACKAGING MOUNTAING AND
				RESPONSE EE COMMAND BITS ARE ALL "1'S": AUTO EE CAPTURE COMMANDED WHEN EE HODE SWITCH SET 10 AUTO. IF DAC RESPONSE EE COMMAND BITS ARE "0'S": LOSS OF EE AUTO COMMANDS.	STRUCTURAL/MECHANICAL/INTEGRITY OF ASSEMBLIES ARE APPLIED. SUCH DESIGN HAS BEEN REVIEWED AND FOUND SATISFACTORY THROUGH THE DESIGN HAS BEEN REVIEWED AND FOUND SATISFACTORY THROUGH THE DESIGN HAS BEEN REVIEWED AND FOUND SATISFACTORY THROUGH THE DESIGN HAS BEEN CHECKLISTS. MATERIAL SELECTION AND USAGE CONFORMS TO SPAR-SG.368 WHICH IS EQUIVALENT TO THE HASA MATERIALS USAGE REQUIREMENTS, WORST CASE ANALYSIS HAS BEEN CONDUCTED TO ENSURE THAT PERFORMANCE CAN BE MET UNDER WORST CASE TEMPERATURE AND AGING EFFECTS. EEE PARTS STRESS ANALYSIS HAS BEEN COMPLETED AND CONFIRMS THAT THE PARTS MEET THE DERATING REQUIREMENTS. PRINTED CIRCUIT BOARD DESIGNS HAVE BEEN REVIEWED TO ENSURE ADEQUATE CIRCUIT PATH WIDTH AND SEPARATION AND TO CONFIRM APPROPRIATE DIMENSIONS OF CIRCUIT SOLDER PADS AND OF COMPONENT
				WORST CASE UNEXPECTED MOTION. SIX JOINT RUNAWAY. AUTOBRAKES. REDUNDANT PATHS REMAINING	PARIS MOUNTING METHODS ARE CONTROLLED IN ACCORDANCE WITH MSFC-STD-136 AND CAE PD93489. THESE DOCUMENTS REQUIRE APPROVED-MOUNTING METHODS, STRESS RELIEF, AND COMPONENT SECURITY. WHERE APPLICABLE, DESIGN DRAWINGS AND DOCUMENTATION GIVE CLEAR IDENTIFICATION OF HANDLING PRECAUTIONS FOR ESD SENSITIVE PARTS.

CIL REV: 0

FMEA REF.	FHEA REV.	HAME GTY B DRAWING REF. DESIGNATION MCIU-DEC DATA INTERFACE GTY-1 SCHEMATIC ED 87305	FAILURE MODE AND CAUSE MODE: LOSS OF DATA BUS. CAUSE(S): (1) LOSS OF SIROBE SIGNAL. (2) LOSS OF CLOCK SIGNAL.	FAILURE EFFECT ON END TIEM 1) AUTO BRAKES (FOR SAFING THE SYSTEM). 2) DIRECT DRIVE AND END EFFECTOR MANUAL DRIVE MODES. (FOR CONTINUING OPERATIONS).	HDWR / FUNC. RATIONALE FOR ACCEPTANCE 2/1R CRITICALITY SCREENS: A-PASS, B-PASS, C-PASS BOARD ASSEMBLY ORAMINGS INCLUDE THE REQUIREMENT FOR SOLDERING STANDARDS IN ACCORDANCE WITH MHB 5300.4(3A) AND JSC 008800A. THE CIRCUIT IS PACKAGED ON A PAIR OF BOARDS MECHANICALLY JOINED BY MACHINED SPACEARS ALONG TWO EGGES TO FORM A JOINED BY MACHINED SPACEARS ALONG TWO EGGES TO FORM A JOINED BY MACHINED SPACEARS ALONG TWO EGGES TO FORM A JOINED BY MACHINED SPACEARS ALONG TWO EGGES TO FORM A JOINED BY MACHINED SUPPORTED IN MACHINED GUIDEMAYS IN MODULE. THE MODULE THE SUPPORTED BY MACHINED BY THE ELECTRONICS PACKAGE. LATERAL RESTRAINT IS PROVIDED BY THO PAIRS OF BOW SPRINGS ENGAGING THE GUIDEMAYS. THE LOWER EDGE OF EACH BOARD INTERFACES VIA A PRINTED CIRCUIT BOARD CONNECTOR, AND THE MODULE IS RESTRAINED BY THE ELECTRONICS ON THE UPPER EDGE OF THE MODULE. THE CONNECTORS WERE ON THE UPPER EDGE OF THE MODULE. THE CONNECTORS WERE ON THE UPPER EDGE OF THE MODULE. THE CONNECTORS AND ALL MODULE PRINTED BOARD CONNECTORS IS ACHIEVED BY MEANS OF PERFORMANCE. INTERCONNECTIONS BETWEEN THE DAC INTERFACE CONNECTORS AND ALL MODULE PRINTED BOARD CONNECTORS IS ACHIEVED BY MEANS OF PERFORMANCE. INTERCONNECTIONS BETWEEN THE FILM WIRRING PACKAGE IS AND HAS KAPION INSULATION. THE FILM WIRRING THE FLECTRONICS PACKAGE, IN ELECTRONICS PACKAGE, IN BELECTRONICS TARY, AND ALL PCB SOCKET ELECTRONICS PACKAGE, THE ELECTRONICS TARY, AND ALL PCB SOCKET CONNECTORS ARE SUPPLIED AS A KIT. THE FILM WIRRING IS INTEGRATED TO THE KIT BY HUGHES. AN ASSEMBLY WAS SUBJECTED TO DICLIPERED ASSEMBLY AND ADMINISTRATED CONTINUOUS AUTOMATIC CONTINUOUS SCAN OF ALL CONTACTS, INSULATION RESISTANCE, AND DIELECTRIC STREWGITH. INTERCONNECTIONS BETWEEN THE ELECTRONICS PACKAGE AND THE PAACL MOUNTED PARTS AND COMPONENTS IS ACHIEVED BY A PRE-FORMED WIRTON MARNESS. PRIOR TO INSTALLATION, THIS MARNESS IS URTING MARNESS. PRIOR TO INSTALLATION, THIS MARNESS IS URTING MARNESS. PRIOR TO INSTALLATION THIS HARMESS IS URSULATION RESISTANCE (500 VDC), AND CONTINUITY. THE TEST PROGRAM

RMS/D&C - 167

SUPERCEDING DATE: HONE

HFUG

PREPARED BY:

DATE: 11 JUL 9

PROJECT: SRMS (-5 MCIU INSTALLED)
ASS'Y MOMENCLATURE: DEC PAHEL

SYSTEM: DEC SUBSYSTEM ASS'Y P/N: 51140E391

SHEET: 3

FMEA REF.	FMEA REV.	NAME OTY & DRAWING REF. DESIGNATION	FAILURE MODE AND	FAILURE EFFECT	HDWR / FUNC. RATIONALE FOR ACCEPTANCE 2/18
1035	G	MCIU-DAC DATA INTERFACE QTY-1 SCHEMATIC ED 87305	CAUSE MODE: LOSS OF DATA BUS. CAUSE(S): (1) LOSS OF STROBE SIGNAL. (2) LOSS OF CLOCK SIGNAL.	END ITEM LOSS OF COMMUNICATION WITH DEC INTERFACE WILL INITIATE DEC INTERFACE WILL INITIATE DEC COMMUNICATION FAILURE DETECTION. AUTOBRAKES. ARN COMES TO REST. GPC GOES INTO IDLE MODE. LOSS OF COMPUTER SUPPORTED HODES. DEC COMMAND DATA IS NOT UPDATED. LOSS OF LIMPING DURING END EFFECTOR CAPTURE. FOR CAUSE 1: DEC RESPONSE DATA IS ALL "O'S". FOR CAUSE 2: DEC RESPONSE DATA FAILS TO ALL "T'S" OR "O'S". IF DEC RESPONSE EE COMMAND BITS ARE ALL "I'S": AUTO EE CAPTURE COMMANDED WHEN EE MODE SWITCH SET TO AUTO. IF DEC RESPONSE EE COMMAND BITS ARE "U'S": LOSS OF EE AUTO COMMANDS. WORST CASE UNEXPECTED MOTION. SIX JOINT RUNAWAY. AUTOBRAKES.	CRITICALITY SCREENS: A-PASS, B-PASS, C-PASS ACCEPTANCE TESTS THE MARQUARE TIEM IS SUBJECTED TO THE FOLLOWING ACCEPTANCE ENVIRONMENTAL TESTING AS PART OF THE DRC PANEL. O VIBRATION: LEVEL AND DURATION - REFERENCE TABLE 1 O THERMAL: *100 DEGREES F TO *10 DEGREES F 2 CYCLES (9.5 HRS PER CYCLE) THE DRC PANEL ASSEMBLY IS FURTHER TESTED AS PART OF THE RMS SYSTEM (TPSTB RMS STROMGBACK TEST AND TPSTS2 FLAT FLOOR TEST). UNICH VERTIFIES THE ABSENCE OF THE FAILURE MODE. OUALIFFICATION TESTS THE DRC PANEL HAS BEEN SUBJECTED TO THE FOLLOWING QUALIFFICATION TEST ENVIRONMENT: O VIBRATION: LEVEL AND DURATION - REFERENCE TABLE 1 O SMOCK: 200/71MS - 3 AKES (6 DIRECTION) O THERMAL: 130 DEGREES F TO -23 DEGREES F (12 HRS PER CYCLE) (6 CYCLES) O HUMIDITY: 9% (120 DEGREES F TO 82 DEGREES F CYCLE IN 16 HRS) 10 CYCLES TOTAL O EMC: HIL-STD-AG1 AS MODIFIED BY SL-E-0002 (TEST CEOT, CE CO), CSD1(CC/AC), CSD2, CSD6, REO2 (B/N), RSD2, RSD3, RSD
				REDUNDANT PATHS REMAINING	

SOCO237A ATTACHHENT -PAGE 42 OF 471

FMEA REF.	FMEA REV.	NAME, OTY, & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HDWR / FUNC. RATIONALE FOR ACCEPTANCE 2/1R CRITICALITY SCREENS: A-PASS R-PASS C-PASS
		DRAWING RÉF.	AND	ON	CRITICALITY SCREENS: A-PASS, B-PASS, C-PASS OA/INSPECTIONS EEE PARIS INSPECTION IS PERFORMED AS REQUIRED BY SPAR-RMS-PA.003. EACH EEE PART IS QUALIFIED AT THE PART LEVEL TO THE REQUIREMENTS OF THE APPLICABLE SPECIFICATION. ALL EEE PARTS ARE 100% SCREENED AND BURNED IN, AS A MINIMUM, AS REQUIRED BY SPAR-RMS-PA.003, BY THE SUPPLIER. ADDITIONALLY, EEE PARTS ARE 100% RE-SCREENED IN ACCORDANCE WITH REQUIREMENTS, BY AN INDEPENDENT SPAR APPROVED TESTING FACILITY. DPA IS PERFORMED AS REQUIRED BY PA.003 ON A RANDOMLY SELECTED 5% OF PARTS, MAXIMUM 5 PIECES, MINIMUM 3 PIECES FOR EACH LOT NUMBER/DATE CODE OF PARTS RECEIVED. WIRE IS PROCURED TO SPECIFICATION MIL-M-22759 OR MIL-M-81381 AND INSPECTED AND TESTED TO MASA JSCHOOBO STANDARD NUMBER 95A. RECEIVING IMSPECTION VERIFIES THAT ALL PARTS RECEIVED ARE AS IDENTIFIED IN THE PROCUREMENT DOCUMENTS, THAT HO PHYSICAL DAMAGE MAS OCCUMENTS PROVIDE ADEQUATE TRACEABILITY INFORMATION AND SCREENING DATA CLEARLY IDENTIFIES ACCEPTABLE PARTS. PARTS ARE INSPECTED THROUGHOUT MANUFACTURE AND ASSEMBLY AS APPROPRIATE TO THE MANUFACTURING STAGE COMPLETED. THESE INSPECTIONS INCLUDE, PRINTED CIRCUIT BOARD INSPECTION FOR TRACK SEPARATION, DAMAGE AND ADEQUACY OF PLATED THROUGH HOLES, COMPONENT MOUNTING INSPECTION FOR CORRECT SOLDERING, MIRE LOOPING, STRAPPING, ETC. OPERATORS AND INSPECTORS ARE TRAINED AND CERTIFIED TO MASA NHB 5300.4(3A) STANDARD, AS MODIFIED BY JSC 08800A. COMFORMAL COATING INSPECTION FOR ADEQUATE PROCESSING IS PERFORMED USING ULTRAVIOLET LIGHT TECHNIQUES. POST P.C. BD. INSTALLATION INSPECTION, CLEANLINESS AND
					MORKMANSHIP (SPAR/GOVERNMENT REP. MANĎATORY INSPECTION POINT) P.C. BD. INSTALLATION INSPECTION, CHECK FOR CORRECT BOARD INSTALLATION, ALIGNMENT OF BOARDS, PROPER CONNECTOR CONTACT MATING, WIRE ROUTING, STRAPPING OF WIRES ETC.,
					PRE-TEST INSPECTION OF D&C PANEL ASSY INCLUDES AN AUDIT OF LOWER TIER INSPECTION COMPLETION, AS BUILD CONFIGURATION VERIFICATION IO AS DESIGN ETC. (SPAR/GOVERNMENT REP. MANDATORY INSPECTION POINT)
					A TEST READINESS REVIEW (TRR) WHICH INCLUDES VERIFICATION OF TEST PERSONNEL, TEST DOCUMENTS, TEST EQUIPMENT CALIBRATION/VALIDATION STATUS AND HARDWARE CONFIGURATION IS CONVENED BY OUALITY ASSURANCE IN CONJUNCTION WITH ENGINEERING, RELIABILITY, CONFIGURATION CONTROL, SUPPLIER AS APPLICABLE, AND THE GOVENMENT REPRESENTATIVE, PRIOR TO THE START OF ANY FORMAL TESTING (ACCEPTANCE OR QUALIFICATION).
]			ACCEPTANCE TESTING (ATP) INCLUDES AMBLENT PERFORMANCE,

SO40237A ATTACHHENT -PAGE 43 OF 47: PROJECT: SRMS (-5 MCIU INSTALLED)
ASS'Y NOMENCLATURE: DEC PANEL

SYSTEM: DEC SUBSYSTEM ASS'Y P/N: 51140E391

SHEET: 5

_				22.1 HOWENCENSTAKE: DI	C PANEL ASS'Y P/H: 51140E391 SHEET: 5
FMEA REF.	FMEA REV.	NAME, GTY, & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HDWR / FUNC. RATIONALE FOR ACCEPTANCE 2/1R CRITICALITY SCREENS: A-PASS, B-PASS, C-PASS
1035	0	MCIU-DEC DATA INTERFACE OTY-1 SCHEMATEC ED 87305	HODE: LOSS OF DATA BUS. CAUSE(S): (1) LOSS OF STROBE SIGNAL. (2) LOSS OF CLOCK SIGNAL.	LOSS OF COMMUNICATION JUSTH D&C INTERFACE WILL INITIATE D&C COMMUNICATION FAILURE DETECTION. AUTOBRAKES. ARM COMES TO REST. GPC GOES INTO IDLE MODE. LOSS OF COMPUTER SUPPORTED MODES. D&C COMMAND DATA IS NOT UPDATED. LOSS OF LIMPING DURING END EFFECTOR CAPTURE. FOR CAUSE 1: D&C RESPONSE DATA IS ALL "0"S". FOR CAUSE 2: D&C RESPONSE DATA FAILS TO ALL "1"S" OR "0"S". IF D&C RESPONSE EE COMMAND BITS ARE ALL "1"S": AUTO EE CAPTURE COMMANDED WHEN EE MODE SWITCH SET TO AUTO. IF D&C RESPONSE EE COMMAND BITS ARE "0"S": LOSS OF EE AUTO COMMANDS.	THERMAL AND VIBRATION TESTING, (SPAR/GOVERNMENT REP. MANDATORY INSPECTION POINT). INTEGRATION OF DAC PANEL, RHC, THC AND MCIU, INSPECTIONS ARE PERFORMED AT EACH STAGE OF INTEGRATION, WHICH INCLUDES GROUNDING CHECKS, INTER CONNECT CABLE VERIFICATION, CONNECTOR INSPECTION FOR BENT OR PUSHBACK CONTACTS ETC. SUB-SYSIEM PERFORMANCE TESTING (ATP), INCLUDES AN AMBIENT PERFORMANCE TEST. (HANDATORY INSPECTION POINT). SRMS SYSTEMS INTEGRATION, THE INTEGRATION OF MECHANICAL ARM, SUBASSEMBLIES AND THE FLIGHT CABIN EQUIPMENT TO FORM THE SRMS. INSPECTIONS ARE PERFORMED AT EACH PHASE OF INTEGRATION WHICH INCLUDES GROUNDING CHECKS, THRU WIRING CHECKS, WIRING ROUTING, INTERFACE CONNECTORS FOR BENT OR PUSH BACK CONTACTS ETC. SRMS SYSTEMS TESTING - STRONGBACK AND FLAT FLOOR AMBIENT PERFORMANCE TEST. (SPAR/GOVERNMENT REP MANDATORY INSPECTION POINT)
				WORST CASE UNEXPECTED MOTION. SIX JOINT RUNAWAY. AUTOBRAKES.	PR
			_	REDUNDANT PATHS REMAINING	

PREPARED BY:

MFWG

SUPERCEDING DATE: NONE

RMS/D&C - 170

DATE: 11 JUL 91

CIL REV: 0

S040237A ATTACHMENT -PAGE 44 OF 47:

PI As	SHEE1: <u>6</u>			
HODE	FAILURE EFFECT	HDWR / FUNC. 2/1R	RATIONALE FOR ACCEPTANCE	
	END TIEM	CRIFICALITY	SCREENS: A-PASS, B-PASS, C-PASS	
DATA	1) AUTO GRAKES	FATLURE HISTORY		

FHEA FHE	A NAME, QTY, &	FAILURE HODE	FAILURE EFFECT	HDWR / FUNC.	RATIONALE FOR ACCEPTANCE	SHEET:
REF. REV	DRAWING REF. DESIGNATION	CAUSE	ON END ITEM	2/1R CRIFICALITY	SCREENS: A-PASS, B-PASS, C-PASS	
FMEA FME REF. TME	'. DRAWÎNG RÊF.	AND	l ON	2/1R CRIFICALITY FAILURE HISTOR	Y . NO FAILURES ASSOCIATED WITH THIS FAILURE	•
PREPARED BY:	HFMG	SUPERCEDING DATE		·	·	

PROJECT: SRMS (-5 MCIU INSTALLED)
ASS'Y NOMENCEATURE: DEC PANEL

SYSTEM: D&C SUBSYSTEM ASS'Y P/N: 51140E391

DATE: 11 JUL 91

FMEA REF.	FHEA REV.	NAME OTY & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END 11EM	HOWR / FUNC. RATIONALE FOR ACCEPTANCE 2/19 CRITICALITY SCREENS: A-PASS, B-PASS, C-PASS
1035	0	MCIU-DAC DATA INTERFACE OTY-1 SCHEMATIC ED 87305	MODE: LOSS OF DATA BUS. CAUSE(\$): (1) LOSS OF STROBE STGMAL. (2) LOSS OF CLOCK STGMAL.	LOSS OF COMMUNICATION WITH D&C INTERFACE WILL INITIATE D&C COMMUNICATION FALLURE DETECTION. AUTOBRAKES. ARM COMES TO REST. GPC GOES INTO IDLE MODE. LOSS OF COMPUTER SUPPORTED MODES. D&C COMMAND DATA IS NOT UPDATED. LOSS OF LIMPING DURING END EFFECTOR CAPTURE. FOR CAUSE 1: D&C RESPONSE DATA IS ALL "0'S". FOR CAUSE 2: D&C RESPONSE DATA FAILS TO ALL "1'S" OR "0'S". IF D&C RESPONSE EE COMMAND BITS ARE ALL "1'S": AUTO EE CAPTURE COMMANDED WHEN EE MODE SWITCH SET TO AUTO. IF D&C RESPONSE EE COMMAND BITS ARE ALL "1'S": LOSS OF EE AUTO COMMANDS. WORST CASE UNEXPECTED MOTION. SIX JOINT RUMANAY.	OPERATIONAL EFFECTS COMPUTER SUPPORTED MODES CANNOT BE USED TO COMPLETE THE MISSION. DIRECT DRIVE AND BACKUP MODES REMAIN. IF PAYLOAD ATTACHED, THE ARM SHOULD BE MANEUVERED TO A SAFE POSITION FOR PAYLOAD RELEASE. LOSS OF MEXT REDUIDANT PATH RESULTS IN BEING ONE TAILURE AWAY FROM IMABILITY TO CARDLE ARM. IF MITH SUBSCOURNT FAILURES ALL DRIVE MODES ARE LOST, THE ARM MAY BE JETTISONED. CREM ACTION USE DIRECT DRIVE CREW TRAINING HOME MISSION CONSTRAINT NONE VERIFY NO DEC/MCIU COMM FAILURES. OMRSD ONLINE INSTALLATION MONE CHASD ONLINE TURNARGUND VERIFY NO DEC/MCIU COMM FAILURES.
			:	AUTOBRAKES. REDUNDANT PATHS REMAINING	100

3040237A

CIL REV: 0

TTEMB LIST	A.S	S'Y HOMENCLATURE: DEC PANE	(SYSTEM; D&C SUBSYSTEM ASS'Y P/N: 511406391	SHEET:
DRAWING REF.	FAILURE MODE AND CAUSE	OR	?/1R	RATIONALE FOR ACCEPTANCE	
MCIU-D&C DATA INTERFACE GTY-1 SCHEMATIC ED 87305	MODE: LOSS OF DATA (BUS. CAUSE(S): (1) LOSS OF STROBE SIGNAL. (2) LOSS OF CLOCK SIGNAL.	1) AUTO BRAKES (FOR SAFING THE SYSTEM). 2) DIRECT DRIVE AND END EFFECTOR MANUAL DRIVE MODES. (FOR CONTINUING OPERATIONS).			
			·		
	· · · · · · · · · · · · · · · · · · ·			1	1
	MAME QTY, & DRAWING REF. DESIGNATION MCIU-D&C DATA INTERFACE QTY-1 SCHEMATIC	ASEA J. DAME, OTY, & FAILURE HODE AND DESIGNATION MCIU-D&C DATA INTERFACE GTY-1 SCHEMATIC ED 87305 MODE: LOSS OF DATA BUS. CAUSE(S): (1) LOSS OF STROBE SIGNAL. (2) LOSS OF CLOCK SIGNAL.	ASS Y MOMERCLATÜRE: DEC PARE AND DRAWING REF. DESTGRATION MCIU-DEC DATA INTERFACE GYT-1 SCHEMATIC ED 87305 MC10-DES OF DATA INTERFACE GYT-1 SCHEMATIC ED 87305 MC10-DEC DATA INTERFACE GYT-1 SCHEMATIC ED 87305 MC10-DEC LOSS OF DATA BUS. (1) LOSS OF STROBE SIGNAL. (2) LOSS OF CLOCK SIGNAL. (2) LOSS OF CLOCK SIGNAL.	ASS'Y HOMENCLATURE: DEC PAREL AND DESIGNATION MCIU-DEC DATA LINTERFACE OTY-1 SCHEMATIC ED 87305 MADE CAUSE MODE: LOSS OF DATA BUS. C1) LOSS OF DATA SCHEMATIC ED 87305 C1) LOSS OF STRORE SIGNAL. MODE: LOSS OF DATA BUS. C1) LOSS OF STRORE SIGNAL. C2) LOSS OF CLOCK SIGNAL. MODE: AND CAUSE FAILURE EFFECT ON REND ITEM CRITICALITY S CRITICALITY S CRITICALITY S CRITICALITY S CRITICALITY S CRITICALITY S CRITICALITY CRITICALITY S CRITICALITY CRITICALITY S CRITICALITY S CRITICALITY S CRITICALITY CRITICALITY S CRITICALITY CRITICALITY S CRITICALITY	ASS'Y MOMERICATORE: DEC PAREL ASS'Y PAREL

ATTACHMENT